

Manhole Inspection Summary

Manhole # S290__044MH

Printed On: 5/28/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **290** Node: **044** Status: **Found**

Insp Date: **4/13/09 1:58 PM**

Incomplete Comments

Crew: **WJ,DH**
Inspector: **wjenkins**
Firm: **PER**

Location Address: **901 W HAMBURG ST**

Cross Street: **S PACA ST**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **4** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **5** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **4** Missing: **0** ☐ Corroded

Surcharge

☐ Evidence Of Surcharge

Depth: **0** (ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S29O__044MH

Printed On: 5/28/2009

Page 2 of 5

Location View



Top View



Miscellaneous



DEBRIS IN CHANNEL

Miscellaneous



DEBRIS ON BENCH

Miscellaneous



Cover Pic

Defect 5



4 INCH OFFSET

Defect 1



Frame & Chimney joint infiltration;
Chimney deterioration - loose brick &
missing mortar

Defect 2



OXIDIZED RUNGS

Manhole Inspection Summary

Manhole # S29O__044MH

Printed On: 5/28/2009

Page 4 of 5

18 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **18** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.34** (ft.) Flow Characteristics: **Slow**
Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease
Silt Depth: **1** (in.) Deposits Extent: **Light**
Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

15 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow

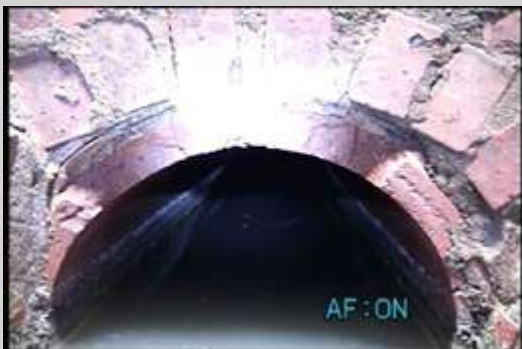

Pipe Height: **15.6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.16** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S29O__044MH

Printed On: 5/28/2009

Page 5 of 5

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.00** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection